



Laser Diode LT-LD-638-1000M-FS-HS

LT-LD-638-1000M-FS-HS is a multimode laser diode with 1W CW output power at 638nm. Its beam pattern is square with $10^\circ \times 10^\circ$ ($\theta_{//} \cdot \theta_{\perp}$). It is supplied in a 5.6mm floating mounted TO-CAN package. The laser diode is suitable for opto-electronic applications.

■ Absolute Maximum Ratings


Parameter	Symbol	Conditions	Value	Unit
Output Optical Power	P_o	CW	1.15	W
LD Reverse Voltage	$V_{R(LD)}$	-	2.0	V
Operating temperature	T_{opr}	-	-10~+40	°C
Storage temperature	T_{stg}	-	-40~+85	°C
Lead soldering temperature (10 sec)	T_{sld}	-	260°C	°C

■ Initial Electrical/Optical Characteristics ($T_c=25^\circ\text{C}$)



Parameter		Symbol	Condition	Min	Typ.	Max	Unit
Threshold Current		I _{th}	CW	-	180	300	mA
Operating Voltage		V _{op}	P _o =1W	-	2.2	3.0	V
Operating current		I _{op}	CW	-	0.9	1.2	A
Centre Wavelength		λ _p	P _o =1W	634	638	644	nm
Beam Divergence*	Parallel	θ//	P _o =1W	1.0	10	20	°
	Perpendicular	θ⊥	P _o =1W	1.0	10	20	°

* Full angle at $1/e^2$ from peak intensity

■ Beam Pattern

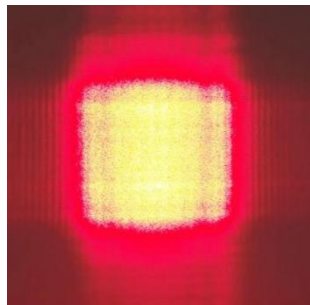

■ Outline Dimension (Unit: mm)

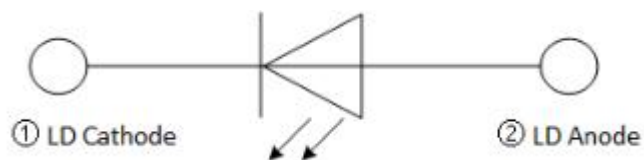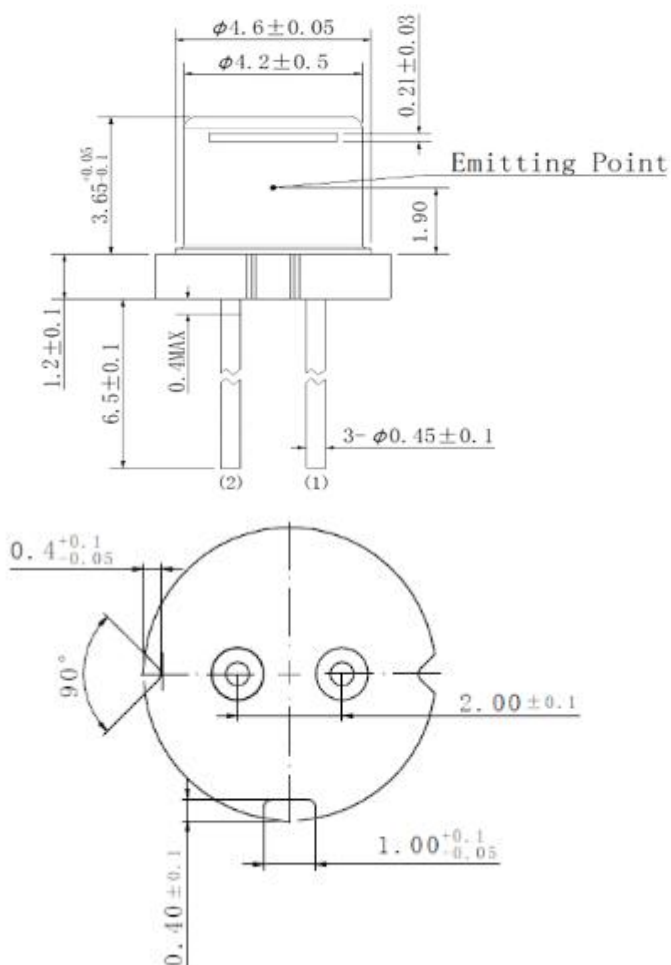

■ Cautions

1. Laser light can damage the human eye and skin. Do not expose the eye and skin to any laser light directly or through optical lenses. Focused laser beam through optical instruments will increase the chance of eye hazard.
2. The laser needs a stable driver to avoid surges. The instantaneous reverse current and reverse voltage should not exceed the absolute maximum ratings, otherwise it will damage the laser diode.
3. Semiconductor lasers are sensitive to temperature, working at high temperatures will reduce the photoelectric conversion efficiency and accelerate the aging of laser diode. It should be used under adequate heat dissipation or cooling conditions.
4. The laser should be used at the rated current and rated power, the output power is too high will accelerate the aging of laser diode.
5. Semiconductor lasers are electrostatic sensitive devices, anti-static measures should be taken during storage and transportation.
6. Lasers should be stored or work in a dry, ventilated environment to prevent damage to the laser from condensation.
7. The light emitting surface (cavity surface) is the key parts of the laser diode, any handling to damage the cavity surface should be strictly prohibited. It should be ensured that the laser diode is not contaminated, and damaged in mechanical.

